

TECHNICAL DATA SHEET

PROPRIETARY RIGHTS NOTICE This document and all information contained within it is the property of Hamilton Beach/Proctor-Silex, Inc. (HB/PS). It is confidential and proprietary and has been provided to you for a limited purpose. It must be returned upon request or destroyed as set forth in the Specification Notice. Disclosure, reproduction or use of this document and any information contained within it, in full or in part, for any purpose is forbidden without the prior written consent of HB/PS. No photographs may be taken of any article fabricated or assembled from this document without the prior written consent of HB/PS.

Recommended parts List

- Extractor Funnel
- Extractor Cone
- Pressure Cup
- Funnel Bracket / Name Plate
- Gear Rack
- Gear Bracket
- Pinion Shaft
- Drip Cup
- Cup Support

Tech Tips

Gear rack Conversion

- Older units with the “square” gear rack can be converted to use currently available parts.
- When replacing an old model gear rack with the current “rounded” gear rack (280009200), you must also replace the pressure cup (980004600) and the gear bracket (210003901).

Defect

- Symptom: handle difficult to pull down / sticking.
- Defect:
 - Gear bracket / rack not aligned over extractor bracket / cone. Align bracket / rack by sighting down the length of the unit from above.
 - Excessive food / juice contamination in the gear bracket / rack. Disassemble juicer and clean appropriately.
 - Pinion gear / gear rack missing teeth, inspect and replace.

Warranty

- The 932 juicer is under warranty from manufacturer defect for 1 year from the date of purchase.
- Cases of unit failure due to customer abuse / misuse will not be covered under warranty.

HAMILTON BEACH / PROCTOR-SILEX, INC. 4421 WATERFRONT DRIVE GLEN ALLEN, VA 23060		HQE-4959: Production Release.			ISSUE CODE	
DRAWN BY: SN	ENG. IN CHG. JOS	DATE: 04/23/07	APPROVED BY:		SP	
INITIAL USE: 932	INITIAL TYPE	SHEET 1 / 1	DRAWING NO. 520003400	REV. A		